

April 3rd 2015

Service Advisory: SA E-04.2

ACK Technologies Inc. model E-04 121.5/406 MHz ELT Serial number 12401 through 12524

E-04.10.1.12 Self test without 406 MHz signal

ELT's with within the above serial number range have a capacitor as shown below in some instances it causes the ELT to not produce a 406 MHz transmission during the self test. This only effects the self test 406 MHz transmission all other ELT functions operate normally and the 406 MHz emergency burst is not effected. If no 406 MHz burst is present during self test remove the capacitor as shown below by cutting the leads and removing the capacitor.

